


UNION SWITCH & SIGNAL COMPANY

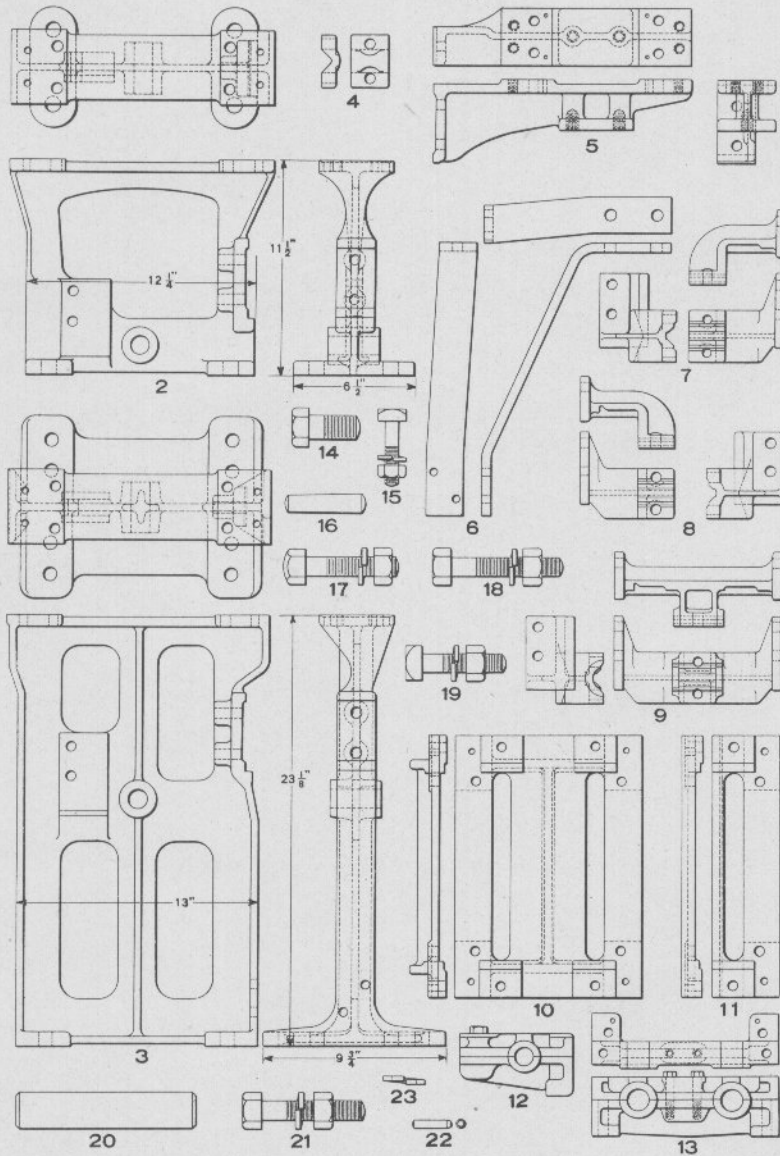

STANDS, FRONT AND BOTTOM RAILS, ETC., FOR
DWARF INTERLOCKING MACHINE

UNION SWITCH & SIGNAL COMPANY

THE DWARF INTERLOCKING MACHINE
DETAIL PARTS

STANDS, FRONT AND BOTTOM RAILS, ETC.

Order by Plate, Piece, Reference and Abbreviated Description Given in
Heavy Face Type Only.

Drawing references are shown for convenience in checking material with
shipping lists and invoices.

Piece	Ref.	Description	Drawing Reference
43867	2	Low Stand	C-4942-25
80357	3	High Stand	C-4942-27
43868	4	Cap	C-1577-3
56407	5	Bracket for low stand	C-1577-1
56408	5a	Bracket for high stand	C-1577-1
96043	6	Support	C-1577-7
43863	7	Bottom Rail, L. H. one-way	B-4259-5
43864	8	Bottom Rail, R. H. 1-way	B-4259-6
43865	9	Bottom Rail, 2-way	B-4259-7
43948	10	Top Plate, 2-Lever	B-4533-7
43947	11	Top Plate, one lever R. or L. Hand	B-4533-7
79188	12	L. H. Front or Back Rail for 1-lever extension	B-7974-5
79189	12a	R. H. Front or Back Rail for 1-lever extension	B-7974-5
79164	13	Front or Back Rail for 2-lever extension	B-7974-14
	14	Tap Bolt, $\frac{5}{8}$ "-11x1 $\frac{3}{8}$ " Hex. Hd. S. with one $\frac{5}{8}$ " Plain S. lock washer ($\frac{7}{32}$ "x1 $\frac{1}{8}$ ") used with top of Support Ref. 6.	
	15	Machine Bolt, $\frac{3}{8}$ "x1 $\frac{3}{4}$ " Sq. Hd. S. with $\frac{3}{8}$ " Hex. Nut and $\frac{3}{8}$ " Plain S. Lock Washer ($\frac{5}{32}$ "x $\frac{3}{32}$ ") used with bottom of Support Ref. 6.	
	16	Pin, No. 8 Std. 2" long, used with Ref. 11.	

Zachary C. Gillihan 2008

PLATE A-153

UNION SWITCH & SIGNAL COMPANY

THE DWARF INTERLOCKING MACHINE DETAIL PARTS

STANDS, FRONT AND BOTTOM RAILS, ETC.

(Continued)

Order by Plate, Piece, Reference and Abbreviated Description Given in
Heavy Face Type Only.

Drawing references are shown for convenience in checking material with
shipping lists and invoices.

Piece	Ref.	Description	Drawing Reference
	17	Machine Bolt, $\frac{1}{2}$ "x $2\frac{1}{2}$ " Hex. Hd. S. with $\frac{1}{2}$ " Hex. Nut and $\frac{1}{2}$ " Plain S. Lock Washer, ($\frac{3}{16}$ "x $\frac{3}{32}$ ") used with cap Ref. 4.	
	18	Machine Bolt, $\frac{1}{2}$ "x3" Hex. Hd. S. with $\frac{1}{2}$ " Hex. Nut and $\frac{1}{2}$ " Plain S. Lock Washer, ($\frac{3}{16}$ "x $\frac{3}{32}$ ") for fastening Ref. 5 to Ref. 2.	
	19	Machine Bolt, $\frac{1}{2}$ "x $2\frac{1}{4}$ " Sq. Hd. with $\frac{1}{2}$ " Hex. Nut and $\frac{1}{2}$ " Plain S. Lock Washer, ($\frac{3}{16}$ "x $\frac{3}{32}$ ").	
4801	20	Pin, 1"x $4\frac{7}{8}$ " for lever shoe.....	B-10234-1
	21	Cap Screw, $\frac{1}{2}$ "x $2\frac{3}{4}$ " Hex. Hd. with nut Ref. 21a and $\frac{1}{2}$ " Plain S. Lock Washer ($\frac{3}{16}$ "x $\frac{3}{32}$ ") used with Ref. 7.	
6774	21a	Nut, for Ref. 21.....	B-8265-2
2356	22	Pin, $\frac{1}{4}$ "x1" used with stand Ref. 2.....	B-8063-1
	23	Lock Washer, $\frac{5}{8}$ " Plain S. ($\frac{7}{32}$ "x $\frac{1}{8}$ ") for Ref. 14.	