


UNION SWITCH & SIGNAL COMPANY

Zachary C. Gillihan 2008

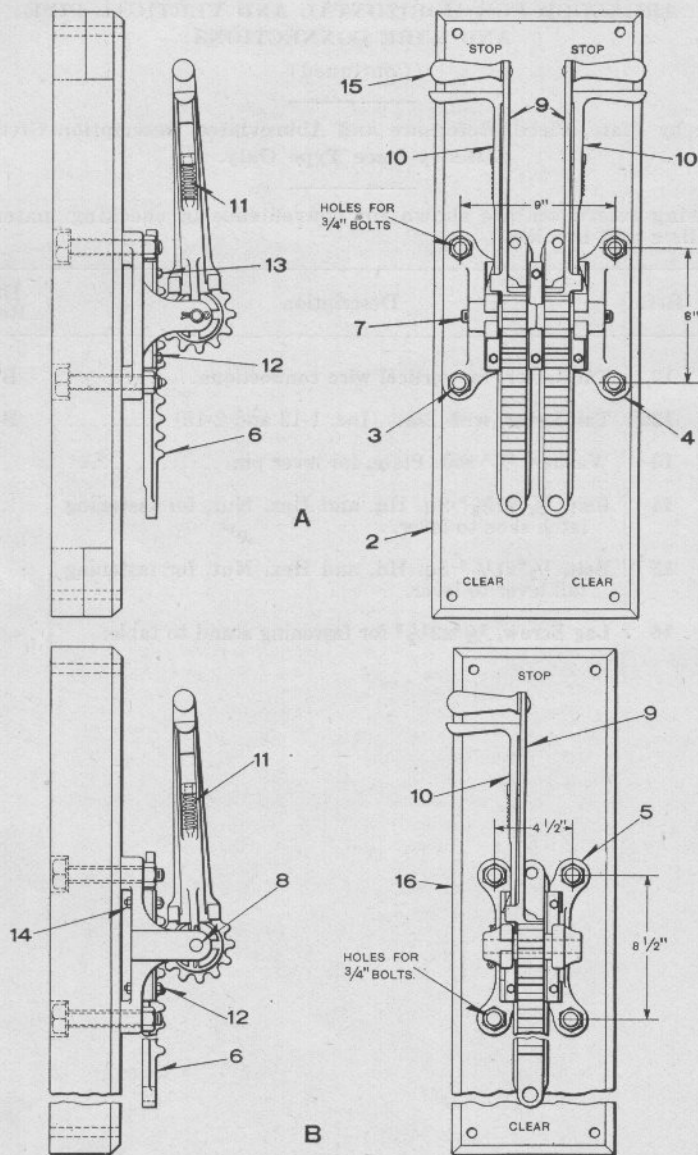

1 AND 2 LEVER, 2 AND 3 POSITIONS, A. R. A. WALL MACHINES

UNION SWITCH & SIGNAL COMPANY

1 AND 2 LEVER, 2 AND 3 POSITIONS, A. R. A. WALL MACHINES
AND DETAILS

Order by Plate, Piece, Reference and Abbreviated Description Given in
Heavy Face Type Only.

Drawing references are shown for convenience in checking material with
shipping lists and invoices.

Piece	Ref.	Description	Drawing Reference
98615	A	2-Lever, 2-Position Rack and Pinion Wall Machine, with base board, bolts, nuts and washers.....	C-4062-21
89006	Aa	2-Lever, 3-Position Rack and Pinion Wall Machine, with base board, bolts, nuts and washers.....	C-4062-21
98547	Ab	2-Lever, 2-Position Rack and Pinion Wall Machine, (without base board, bolts, nuts and washers)....	C-4062-21
97227	Ac	2-Lever, 3-Position Rack and Pinion Wall Machine, (without base board, bolts, nuts and washers)....	C-4062-21
	B	1-Lever, 2-Position, Rack and Pinion Wall Machine, (with base board, bolts, nuts and washers).....	C-4062-22
	Ba	1-Lever, 2-Position Rack and Pinion Wall Machine, complete (without base board, bolts, nuts and washers).....	C-4062-22
	Bb	1-Lever, 3-Position Rack and Pinion Wall Machine, complete (with base board, bolts, nuts and washers)	C-4062-22
126037	Bc	1-Lever, 3-Position, Rack and Pinion Wall Machine, (without base board, bolts, nuts and washers)....	C-4062-22
56495	2	Base Board for Refs. A and Aa.....	C-4224-7
	3	Bolt, $\frac{3}{4}$ "x $\frac{5}{16}$ " Sq. Hd. with hex. nut and std. plate washer for attaching Refs. Ab, Ac and Bd to 2 and 16.	
98546	4	Stand, 2-Lever, 2-Position.....	C-1571-9
89007	4a	Stand, 2-Lever, 3-Position.....	C-1571-9
	5	Stand, 1-Lever, 2-Position.....	C-1571-9
126036	5a	Stand, 1-Lever, 3-Position.....	C-1571-9

Zachary C. Gillihan 2008

PLATE A-193

UNION SWITCH & SIGNAL COMPANY

1 AND 2 LEVER, 2 AND 3 POSITIONS, A. R. A. WALL MACHINES AND DETAILS

(Continued)

Order by Plate, Piece, Reference and Abbreviated Description Given in
Heavy Face Type Only.

Drawing references are shown for convenience in checking material with
shipping lists and invoices.

Piece	Ref.	Description	Drawing Reference
88961	6	Rack for Wall Machines (with $\frac{5}{8}$ " Hole one end and $\frac{7}{8}$ " Hole other end)	C-4224-7
5408	7	Pin, $\frac{3}{4}$ "x $\frac{7}{8}$ ", with two $\frac{3}{16}$ "x $1\frac{1}{4}$ " cotters for 2-lever wall machines	B-10221-1
126038	8	Pin, $\frac{3}{4}$ "x $5\frac{3}{4}$ ", with one $\frac{3}{16}$ "x $2\frac{1}{4}$ " cotter for 1-lever machine	8076-78
89005	9	Lever, with Handle, M. I. Pat. T-89004	B-8140-11
89003	10	Latch Handle, M. I. Pat. T-89003	B-8260-7
88600	11	Coil Spring	7770-263
15169	12	Rack Retainer Bar	C-4224-5
	13	Cap Screw, $\frac{1}{4}$ "-30x $\frac{3}{4}$ " Hex. Hd. for attaching 12 to A, Aa, Ab and Ac.	
	14	Bolt, $\frac{1}{4}$ "-20x2" Hex. Hd. with Hex. Nut for attaching 12 to B and Ba.	
89002	15	Handle only for 9	8311-66
	16	Base Board for Ref. B	C-4224-7